
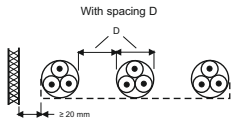
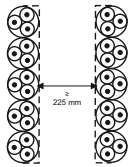
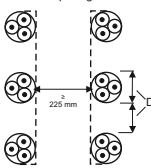

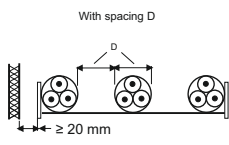


Correction factors for bunched multicore cables

Multicore cables laid in the air - Installation Method E

Installation method	Number of cable tray or ladder	Number of multicore cables						
		1	2	3	4	6	9	
		Correction factors						
Horizontal perforated cable trays  <p>Without a spacing</p> <p>≥ 20 mm</p>  <p>With spacing D</p> <p>≥ 20 mm</p>	1	1,00	0,88	0,82	0,79	0,76	0,73	
	2	1,00	0,87	0,80	0,77	0,73	0,68	
	3	1,00	0,86	0,79	0,76	0,71	0,66	
	1	1,00	1,00	0,98	0,95	0,91	-	
	2	1,00	0,99	0,96	0,92	0,87	-	
	3	1,00	0,98	0,95	0,91	0,85	-	
Vertical perforated cable trays  <p>Without spacing</p> <p>≥ 225 mm</p>  <p>With spacing D</p> <p>≥ 225 mm</p>	1	1,00	0,88	0,82	0,78	0,73	0,72	
	2	1,00	0,88	0,81	0,76	0,71	0,70	
	1	1,00	0,91	0,89	0,88	0,87	-	
	2	1,00	0,91	0,88	0,87	0,85	-	
	Horizontal ladder, cable clamps etc.  <p>Without spacing</p> <p>≥ 20 mm</p>  <p>With spacing D</p> <p>≥ 20 mm</p>	1	1,00	0,87	0,82	0,80	0,79	0,78
		2	1,00	0,86	0,80	0,78	0,76	0,73
3		1,00	0,85	0,89	0,76	0,73	0,70	
1		1,00	1,00	1,00	1,00	1,00	-	
2		1,00	0,99	0,98	0,97	0,96	-	
3		1,00	0,98	0,97	0,96	0,93	-	